

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Survey report on:

Surveyor Reference	EA1617
Customer	Mr. G Steer
Selling address	35 High Street Edzell DD9 7TA
Date of Inspection	23/05/2024
Prepared by	Gary Black, MRICS Dundee - Allied Surveyors Scotland Ltd

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Mid-terraced traditional dwelling house over 2 levels.
Accommodation	GORUND FLOOR Vestibule, Lounge, Living Room, Kitchen, Shower Room. UPPER FLOOR Landing, 3 Bedrooms, Shower Room.
Gross internal floor area (m2)	141
Neighbourhood and location	The property is located within the village of Edzell, a few miles from Brechin. Surrounding properties are generally of a similar age and character and there are commercial properties in the general locality. All amenities can be found within comfortable commuting distance.
Age	140 years approx.
Weather	Dry.
Chimney stacks	The chimneys are of stone and brick construction. <i>Visually inspected with the aid of binoculars where required.</i>


<p>Roofing including roof space</p>	<p>The roof is of multi-pitched type clad in slates with tiled and zinc ridging and zinc hips. The roof incorporates flush dormers and valley gutters, including central gutters which were unseen. From ground level the roof may only be partially viewed.</p> <p>Where viewed the roof is of pitched timber truss type with timber sarking. The void is part floored and insulation is installed.</p> <p><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></p> <p><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></p> <p><i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i></p>
<p>Rainwater fittings</p>	<p>The rainwater fittings are PVC, cast-iron and zinc.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p>
<p>Main walls</p>	<p>The property is of traditional stone and brick construction, lined internally and roughcast/painted externally. The walls incorporate sub-floor ventilation.</p> <p><i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i></p>
<p>Windows, external doors and joinery</p>	<p>The windows are of mixed age uPVC double glazed design. There is a rooflight over the staircase. The property is accessed by uPVC glazed front and rear doors.</p> <p><i>Internal and external doors were opened and closed where keys were available.</i></p> <p><i>Random windows were opened and closed where possible.</i></p> <p><i>Doors and windows were not forced open.</i></p>
<p>External decorations</p>	<p>The main walls, rainwater fittings and external timbers are painted.</p> <p><i>Visually inspected.</i></p>
<p>Conservatories / porches</p>	<p>Not applicable.</p>
<p>Communal areas</p>	<p>Not applicable.</p>
<p>Garages and permanent outbuildings</p>	<p>Outbuildings comprise a detached single garage and a timber/felt summerhouse.</p> <p>The garage is of concrete sectional construction with pitched roof clad in fibre cement sheets.</p> <p><i>Visually inspected.</i></p>

Outside areas and boundaries	<p>There is garden ground to the front and rear of the property, including off-street parking to the rear. Boundaries comprise brick wall, concrete block wall, hedging, timber fencing and metal railings.</p> <p>Visually inspected.</p>
Ceilings	<p>The ceilings are lath/plaster and plasterboard and are partially coombed at upper level.</p> <p>Visually inspected from floor level.</p>
Internal walls	<p>The internal walls are brick and lath/plaster. The surfaces are decorated and partially clad.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>The floors are timber and concrete. Due to fully fitted floorcoverings and stored items no detailed inspection was possible and no access was gained to any sub-floor area.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
Internal joinery and kitchen fittings	<p>The internal doors are timber and timber/glazed. The kitchen units appear fairly modern. The staircase is timber. The property has fitted storage space.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>Within the main lounge there is a fireplace with living flame gas fire.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
Internal decorations	<p>Internal surfaces are papered/painted.</p> <p>Visually inspected.</p>
Cellars	Not applicable.

<p>Electricity</p>	<p>Mains supply. The meter and consumer unit are in the lounge.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Gas</p>	<p>Mains supply. The meter is in the entrance vestibule.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Water, plumbing and bathroom fittings</p>	<p>Mains supply. Where viewed the plumbing system is of traditional materials. There is a sink unit in the kitchen. Sanitary fittings in the property are mixed in age.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</p>
<p>Heating and hot water</p>	<p>Heating is by a gas system. There is a condensing combination boiler located off the living room. Hot water is supplied by the heating system.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Drainage</p>	<p>To a mains sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>

<p>Fire, smoke and burglar alarms</p>	<p>Alarms are installed.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>Asbestos was commonly used in building materials up to the end of the 20th century by which time it became a banned substance. The current informed view is that provided these remain in good condition and undisturbed then they should present no significant hazard to health. In the event of damage or disturbance, however, above average costs may be incurred for repair or removal by a Specialist Contractor. Care should be taken when carrying out maintenance, repair or renewal.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</p>

Sectional Diagram showing elements of a typical house

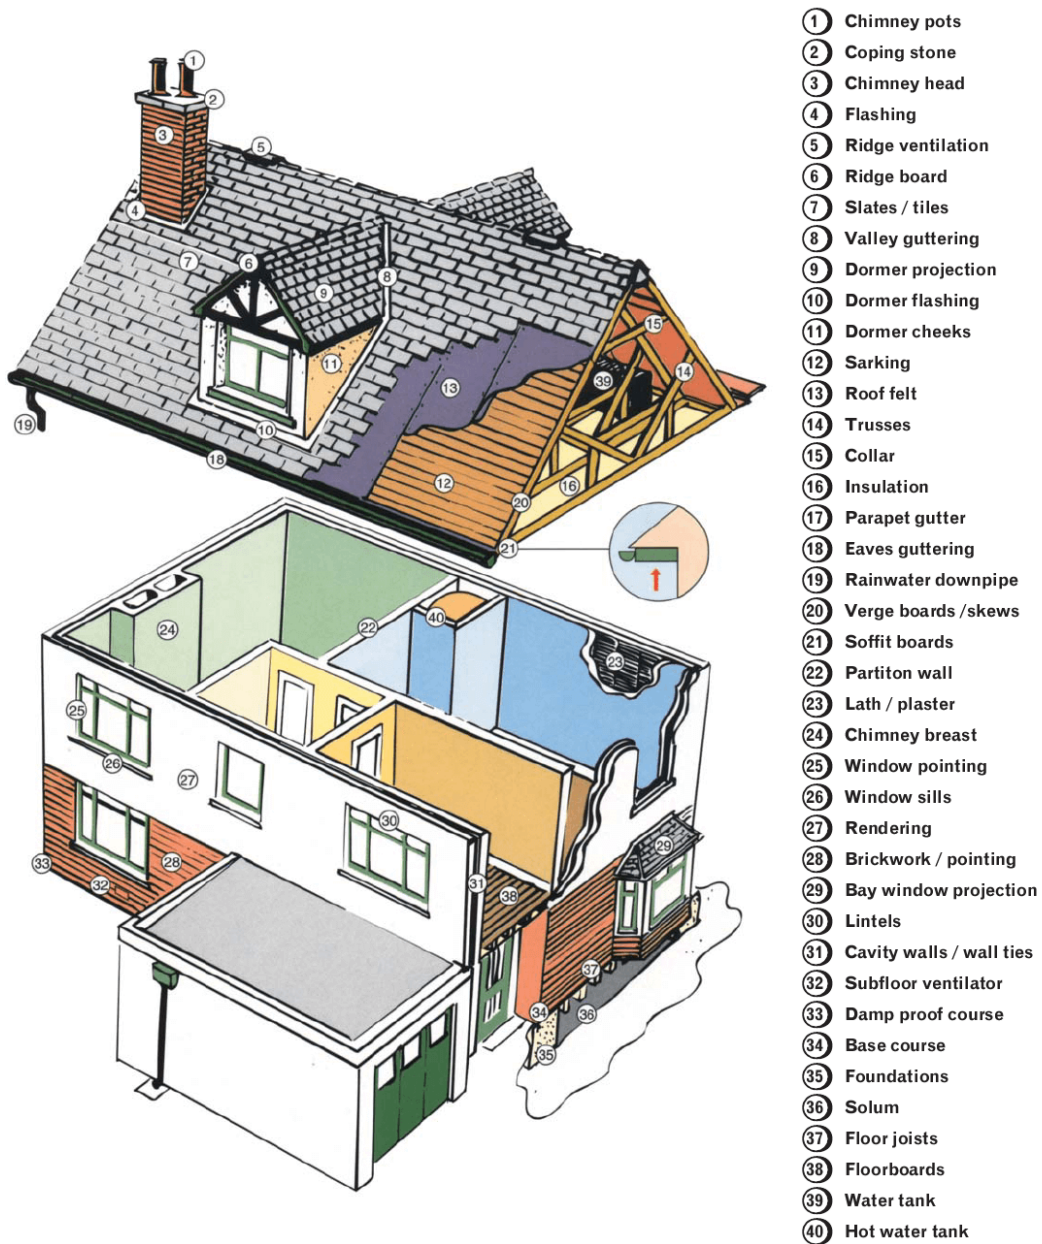

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	There is no evidence of recent or ongoing movement.

Dampness, rot and infestation	
Repair category:	2
Notes:	The property has been inspected by Martin Property Care Ltd. Repairs should be carried out as soon as possible.

Chimney stacks	
Repair category:	1
Notes:	Typical weathering noted. Chimney flashings require updating from time to time.

Roofing including roof space	
Repair category:	2
Notes:	The roof covering appears on largely original lines and is affected by general weathering to slates and metalwork along with one or two broken and dislodged slates. The roof should be expected to require ongoing maintenance and indeed an annual inspection is recommended. Flat sections of roofing can have a limited life. Valley gutters are a common cause of damp penetration and require careful maintenance.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings	
Repair category:	1
Notes:	No significant defects noted.

Main walls	
Repair category:	1
Notes:	Fair overall condition. Pockets of boss roughcast were detected and hairline cracking will require to be attended to in due course.

Windows, external doors and joinery	
Repair category:	1
Notes:	The windows are mixed in age and where tested were found to be in satisfactory working order. With the passage of time the windows will be prone to the failure of mechanisms and seals and in particular relation to the older windows. The older windows have limited ventilation incorporated. Both external doors were tested and were found to operate satisfactorily.

External decorations	
Repair category:	1
Notes:	Regular updating is recommended.

Conservatories / porches	
Repair category:	
Notes:	Not applicable.

Communal areas	
Repair category:	
Notes:	Not applicable.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and permanent outbuildings

Repair category:	2
Notes:	The outbuildings are showing signs of age. Specialist advice should be taken prior to any handling of the garage roof sheets. These may contain small amounts of asbestos fibres.

Outside areas and boundaries

Repair category:	1
Notes:	Boundaries appear well defined and fences/walls are in acceptable condition (where viewed).

Ceilings

Repair category:	1
Notes:	Some unevenness noted. Cornicing is cracked due to past movement. Staining to the rear hall ceiling is dry.

Internal walls

Repair category:	1
Notes:	Some plaster filling may be necessary during future redecoration. Some decorative surfaces are finished with an Artex type product. Early forms of Artex may incorporate small amounts of asbestos based bonding materials and therefore specialist advice should be obtained prior to working on these areas to minimize the risk of releasing hazardous fibres.

Floors including sub-floors

Repair category:	1
Notes:	No immediate action necessary.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal joinery and kitchen fittings

Repair category:

1

Notes:

The internal joinery is in keeping with a property of this type and age. There is typical wear and tear apparent.

Internal glazing should be of safety glass type.

Chimney breasts and fireplaces

Repair category:

1

Notes:

Chimneys should be swept/cleared prior to any future use.

Annual servicing of the gas fire is recommended. Current test certification should be obtained.

Internal decorations

Repair category:

1

Notes:

To a fair standard throughout.

Cellars

Repair category:

Notes:

Not applicable.

Electricity

Repair category:

1

Notes:

The system appears satisfactory, nonetheless current test certification should be obtained.

It is generally recommended to check electrical systems every 5 years or upon taking possession of a property.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Gas	
Repair category:	1
Notes:	It is appropriate to have gas fittings tested on a regular basis.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	The plumbing system appears functional, although was not tested.

Heating and hot water	
Repair category:	1
Notes:	A gas heating system is installed. Annual servicing is recommended. Current test certification should be obtained.

Drainage	
Repair category:	1
Notes:	There is no evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and Upper.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>Tenure is assumed absolute ownership.</p> <p>We are unaware of any adverse proposals affecting the subjects although this can be confirmed by obtaining a Property Enquiry Certificate.</p> <p>There is no evidence of recent alterations.</p> <p>It is understood that the neighbour has a right of access over the rear access drive.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
The subjects should be insured for a sum of not less than £600,000.	
Valuation (£) and market comments	
<p>Market value assuming vacant possession is £250,000.</p> <p>Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.</p>	
Report author:	Gary Black, MRICS
Company name:	Dundee - Allied Surveyors Scotland Ltd
Address:	8 Whitehall Crescent Dundee DD1 4AU
Signed:	Electronically Signed: 259776-7c6569ca-554c
Date of report:	24/05/2024